

To: All Distributors
Regional Sales Managers and National Sales Manager

From: LabriePlus Service

Model: Expert and Automizer

Subject: New parts- Labrie Dash Light


Earlier Lights- ELL00402



New Dash Lights- CIC02755



The earlier Labrie dash light assembly, **ELL00402**, is now discontinued by the supplier. If you need to replace part of the old one, you will need to change the entire **ELL00402** assembly to **CIC02755**, along with plate **210377** and use electrical diagram **151092** for a description of how to modify the connection.

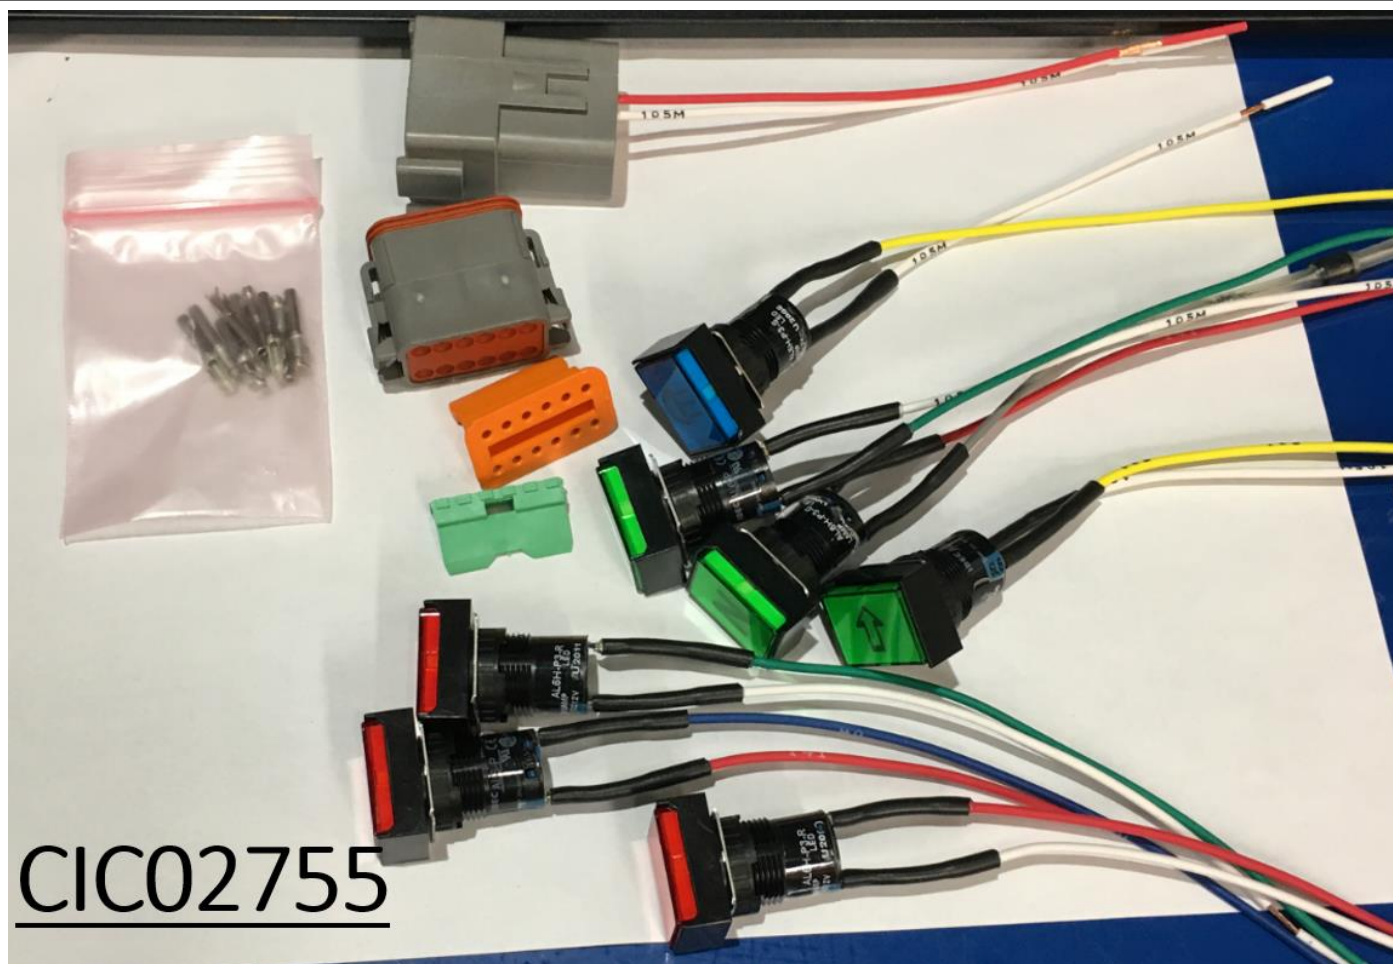


Procedure to change ELL00402 (old lights) for CIC02755 (new lights)

REMOVED ORIGINAL CONNECTOR TYCO

CM2

56A	1
40	2
538	3
52	4
805	5
805	6
105A	7
57A	8
141	9
105M	10

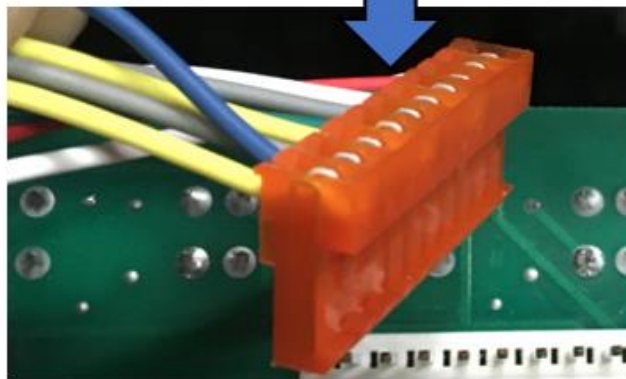

INSTALLED DEUTSCH CONNECTOR 12 PINS

(1X) CONNECTOR ELC04500
 (10X) TERMINALS ELT12500
 (1X) LOCK ELC06500

56A	CM1	1	←	1	←	56A
40	2	←	2	←	40	
538	3	←	3	←	538	
52	4	←	4	←	52	
805	5	←	5	←	805	
805	6	←	6	←	805	
105A	7	←	7	←	105A	
57A	8	←	8	←	57A	
141	9	←	9	←	141	
105M	10	←	10	←	105M	
	11	←	11	←		
	12	←	12	←		



DEUTSCH CONNECTOR 12 PINS

(1X) CONNECTOR ELC05500
 (9X) TERMINALS ELT12000
 (1X) LOCK ELC07500

